


Typ HF—F

1. Ware möglichst frostfrei lagern. Keine Montage bei Frost!
2. Vor Einbau auf Transportschäden achten!
3. Auf Durchflussrichtung achten!
4. **Keine Zug- oder Biegebelastung ausüben!**
Wir empfehlen den Einsatz von Kompensatoren und Auflagern um auftretende Spannungen zu vermeiden.
5. Verbindungsschrauben an Ein- und Ausgangsflansch nach Abbildung anziehen.
Maximales Anzugmoment sind 25 Nm.
6. Der maximale Betriebsdruck beträgt 8 bar.
Die maximale Betriebstemperatur beträgt 45°C

1. Prior to installation check whether any transport damage has occurred.
2. Resin traps have to be stored free from frost, do not install at temperatures below 5°C.
3. Check flow direction.
4. **Do not exert any tensile stress or bending stress.**
We recommend the use of compensators and supports to reduce occurring stresses.
5. Tighten connection bolts according illustration.
Max tightening torque is 25 Nm.
6. Maximum operation pressure is 8 bar.
Maximum operation temperature is 45°C.

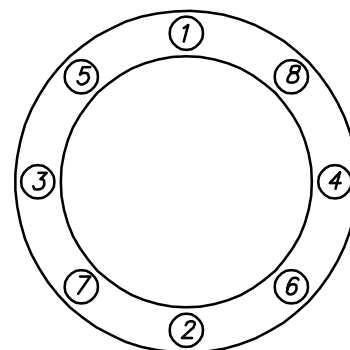

DN80—3" PN10 FULL FACE FLANGE CONNETION

